

NEW OZ TIMBER FLOORING

TEST REPORT

REPORT NUMBER

180814010SHF-BP-1

ISSUE DATE

2018/9/10


PAGES

4

DOCUMENT CONTROL NUMBER

LFT-APAC-SHF-OP-10a

© 2018 INTERTEK

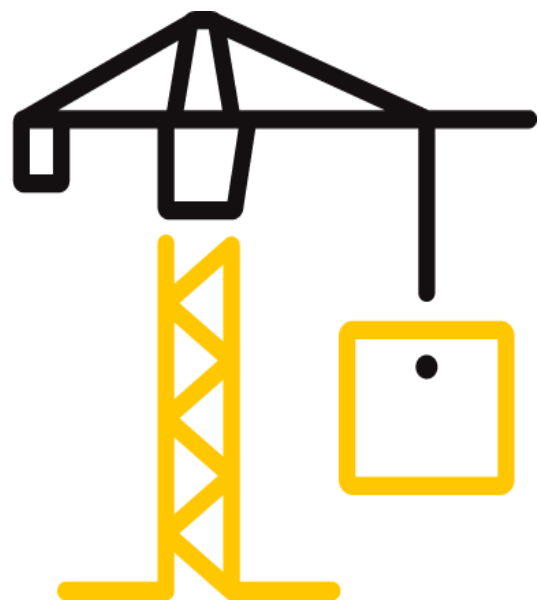

Test Report

Issue Date: 2018/9/10 Intertek Report No. 180814010SHF-BP-1

Applicant: NEW OZ TIMBER FLOORING
Applicant Address: 2/262 PARRAMATTA ROAD GRANVILLE, 2142 NSW AUSTRALIA**SUBJECT:** Performance testing
Stone Floor

Dear Sir,

This test report represents the results of our evaluation of the above referenced product(s) to the requirements contained in the following standards:

TEST METHODS AND STANDARDS
Refer to the next following Pages.

SAMPLE ID	MODEL	SPECIFICATION
S180814010SHF.001	1600*180*8.0mm	/

SAMPLE RECEIVED: 2018/8/13
TESTED FROM: 2018/8/14 TO 2018/9/10

This report is for the exclusive use of Intertek's Client and is provided pursuant to the agreement between Intertek and its Client. Intertek's responsibility and liability are limited to the terms and conditions of the agreement. Intertek assumes no liability to any party, other than to the Client in accordance with the agreement, for any loss, expense or damage occasioned by the use of this report. Only the Client is authorized to permit copying or distribution of this report and then only in its entirety. Any use of the Intertek name or one of its marks for the sale or advertisement of the tested material, product or service must first be approved in writing by Intertek. The observations and test results in this report are relevant only to the sample tested. This report by itself does not imply that the material, product, or service is or has ever been under an Intertek certification program.

Test Report

Issue Date: 2018/9/10

Intertek Report No. 180814010SHF-BP-1

Test Items, Method and Results:

Test Item: Formaldehyde content test

Test Method: With reference to EN 717-1:2004 chamber method, formaldehyde content was detected by UV-VIS spectrophotometer.

Test condition:

Chamber type:	1 m ³ stainless steel chamber
Climatic conditions:	23°C, 45% R.H.
Air exchange rate:	1.0 h ⁻¹
Loading factor:	1.0 m ² /m ³
Test duration:	222 hours
Test result:	ND

Note:

1. mg/m³ = milligram per cubic meter
2. ND = Not Detected
3. Detection limit = 0.02 mg/m³

Test Report

Issue Date: 2018/9/10

Intertek Report No. 180814010SHF-BP-1

APPENDIX: SAMPLE RECEIVED PHOTO



REPORT AUTHORIZED

When signed with physical or electronic signature, the contents of this report have been prepared and approved per Intertek's quality process in accordance with ISO 17025.

Flora Fan
Name: Flora Fan
Title: Reviewer

Grace Wang
Name: Grace Wang
Title: Project Engineer



Revision:

NO.	DATE	CHANGES	AUTHOR	REVIEWER
180814010SHF-BP-1	2018/9/10	First issue	Grace Wang	Flora Fan